



MINISTERIO DE TRANSPORTES,
TURISMO Y COMUNICACIONES
DIRECCION GENERAL DE AVIACION CIVIL

AIRWORTHINESS
DIRECTIVE

NUMBER
01/91

SHEET
1/1

AFFECTED PRODUCT: Engines TPE-331-5 mounted in CASA C-212-CB.

MANUFACTURER: GARRET ENGINE DIVISION, ALLIED SIGNAL, INC.

ISSUE DATE: January , 1.991

REFERENCES: Airworthiness Directives FAA-AD-90-21-01 and GARRET SE
TPE 331-A72-0699, R2.

EFFECTIVITY DATE: January 26 , 1.991

DESCRIPTION: This Airworthiness Directive require the periodic replacement of the turbine third stage stator (P/N 868379-5) in indicated engines, with the intention of preventing thermal fatigue.

COMPLIANCE: The replacement should take place in accordance with the following schedule:

- a) Replace within the next 300 cycles in service after the effectivity date of this AD, if the stator assembly has more than 1500 cycles since new or since rework.
- b) Replace prior to accumulating 1800 cycles in service since new or since rework, if the stator assembly has less than 1500 cycles on the effectivity date of this AD.
- c) Replace at intervals not to exceed 1800 cycles in service since new or rework.

ADDITIONAL INFORMATION: Dirección General de Aviación Civil
Area Técnica de Certificación
Attn. Sr. Iglesias
Pza. San Juan de la Cruz, s/n.
28071 MADRID
Tlfn. 91-553.79.76 Tx. 48839 CIAL E
FAX: 91-553.50.14 AFTN: LEAC ZX CX

THIS AIRWORTHINESS DIRECTIVE IS A TRANSLATION FROM THE SPANISH ORIGINAL ISSUE