



Ministerio de Fomento
Secretaría de Estado de Infraestructuras
y Transportes
Dirección General de Aviación Civil

AIRWORTHINESS
DIRECTIVE

NUMBER:
01/95 Rev.2

SHEET:
1/2

AFFECTED PRODUCT: Aircraft CASA CN-235, CN-235-100 and CN-235-200.

MANUFACTURER: CONSTRUCCIONES AERONAUTICAS S.A. (CASA)

ISSUE DATE: February ,1999.

REFERENCE: Service Bulletin 35-CSB-32-001 issued by Construcciones Aeronáuticas.

EFFECTIVITY: February ,1999.

DESCRIPTION: Due to the failure of the nose landing gear turning tube P/N 63433 (D61178) in one CN-235 aircraft, and later cracks detection in that element of others same type of aircraft, the Dirección General de Aviación Civil issued the Airworthiness Directives 01/95 and 01/95 Rev. 1, which required some inspections to be performed, during the period the analysis of the problem is in progress. Having finished the above mentioned process, and based on its results, the CN-235 nose landing gear must be modified by replacing actual turning tubes by those with new design P/N GA65924 (D65491), according to the instructions in Service Bulletin 35-CSB-32-001 issued by Construcciones Aeronáuticas.

From the effective date of this AD, the Airworthiness Directives 01/95 and 01/95 Rev.1 are cancelled.



Ministerio de Fomento
Secretaría de Estado de Infraestructuras
y Transportes
Dirección General de Aviación Civil

AIRWORTHINESS
DIRECTIVE

NUMBER:

01/95 Rev. 2

SHEET:

2/2

COMPLIANCE: The referred modification must be accomplished before turning tubes installed have achieved 4800 landings.

ADDITIONAL INFORMATION: For further information contact:
Dirección General de Aviación Civil
Area Técnica de Certificación
Att. Mr. Juan Díaz
Paseo de la Castellana 67
28071 MADRID
Tfn.: 34-91-5975223
TX: 48339 CIAL E
FAX: 34-91-5978584
AFTN: LEAC ZX CX