



Ministerio de Fomento  
Secretaría de Estado de  
Infraestructuras y Transportes  
Dirección General de Aviación Civil

**AIRWORTHINESS**

**DIRECTIVE**

NUMBER:  
04 / 99

SHEET:  
1 / 1

**AFFECTED PRODUCT:** Aircraft CASA CN-235, CN-235-100 and CN-235-200.

**MANUFACTURER:** Construcciones Aeronáuticas, S.A. (CASA).

**ISSUE DATE:** 30 July 1999.

**REFERENCE:** Service Bulletin 235-30-14 issued by Construcciones Aeronáuticas or later approved revisions.

**EFFECTIVE :** 1<sup>st</sup> August 1999.

**DESCRIPTION:** During a review of the airframe pneumatic de-icing system of CN-235 series, it was detected that a failure condition exists in which the pneumatic supply pressure to the pneumatic boot de-icers could be less than 15 psig, which is the required pressure for proper functioning, without generating the corresponding caution light in the cockpit.

This Airworthiness Directive mandates a modification to ensure that the flight crew is advised whenever the supply pressure to the pneumatic boot de-icers is below the required value for its proper operation

**COMPLIANCE SCHEDULE:** The CASA modification must be accomplished within 4 months.

**ADDITIONAL INFORMATION:** For further information contact:  
Dirección General de Aviación Civil.  
Subdirección General de Control del Transporte Aéreo.  
Attn. Mr. Ramírez Ciriza.  
Paseo de la Castellana, 67. 28071 Madrid.  
e-mail: jmramirez@mfom.es  
Tel.: +34 915978858  
Fax: +34 915978584

THIS AIRWORTHINESS DIRECTIVE IS A TRANSLATION FROM THE SPANISH ORIGINAL ISSUE