



Ministerio de Obras Públicas, Transportes
y Medio Ambiente
Secretaría General para los Servicios
de Transportes
Dirección General de Aviación Civil

**AIRWORTHINESS
DIRECTIVE**

NUMBER:
05/96

SHEET:
1/1

AFFECTED PRODUCT: All CASA C-212 Aircraft Models.
MANUFACTURER: Construcciones Aeronáuticas, S.A. (CASA).
ISSUE DATE: May 13, 1996.
REFERENCE: Service Bulletin 212-27-48.
EFFECTIVE DATE: Upon reception.

DESCRIPTION: In at least one C-212 airplane, the hinges of the ailerons command bars located at the bottom of the flight controls column have been found deteriorated. That is due to the unadequate dimensions of the retainer washer P/N 212-46138-05.1 and a loss of the joint can occur.

COMPLIANCE: The above referred washer must be replaced, according to instructions in the Service Bulletin 212-27-48 Original or later approved revisions, by the new design washers. The modification must be accomplished earlier than 100 flight hours after the effective date of this Airworthiness Directive.

ADDITIONAL INFORMATION: For any additional information contact:
Dirección General de Aviación Civil.
Area Técnica de Certificación.
(J. Díaz.)
Plaza de San Juan de la Cruz s/n
28071 Madrid
Tlf: 34-1-597-6930
Fax: 34-1-597-6853
Tlx: 48339 CIAL E
AFTN: LEAC ZX CX.